

Installation Instructions

Cabin Filter

Instrucciones de montaje

Filtro de habitaculo

Notice de montage

Filtre d'habitacle

C25664

LOCATION: BEHIND THE GLOVE COMPARTMENT*

QUANTITY USED: 1


DEGREE OF DIFFICULTY: MODERATE




ESTIMATED INSTALLATION TIME: 24 MINUTES

BMW 1992-98 3 Series

NOTE: Obtain the radio anti-theft code prior to disconnecting the battery ground cable.

1. Open the hood and disconnect the battery ground cable
2. On all models except convertible, disengage the two air nozzles located above the glove compartment at the top. Position the nozzles straight ahead, then remove the nozzles.
3. On all models, remove the glove compartment retaining screws located at each side. On convertible models, the upper two screws are accessed through the air nozzle opening.
4. Disconnect the glove compartment lamp.
5. Remove the two lower glove compartment retaining screws.
6. Disconnect the glove compartment electrical connectors, then remove the glove compartment.
7. Remove the righthand side lower trim panel.
8. Disengage the footwell air duct clip, then remove the air duct.
9. Remove the two control module bracket retaining screws, then tilt the module downward Figure 1.
10. Rotate the cabin filter cover retainer 45°, then remove the cover Figure 2.
11. Remove the cabin air filter element from the filter housing Figure 3.
12. Install the new cabin air filter into the filter housing.
13. Install the cabin air filter cover. Turn the cover retainer 45° to lock in position.
14. Position the control module bracket, then install the two retaining screws.
15. Install the footwell air duct.
16. Position the glove compartment to the instrument panel, then connect the electrical connectors.
17. Install the lower glove compartment retaining screws.
18. Connect the glove compartment lamp.
19. On all models except convertible, install the two air nozzles located above the glove compartment. On all models, connect the battery ground cable, then enter the radio anti-theft code.

! WARNING	
	Turn The Engine Off Failure to do so may cause electrocution, burns and severe injury.

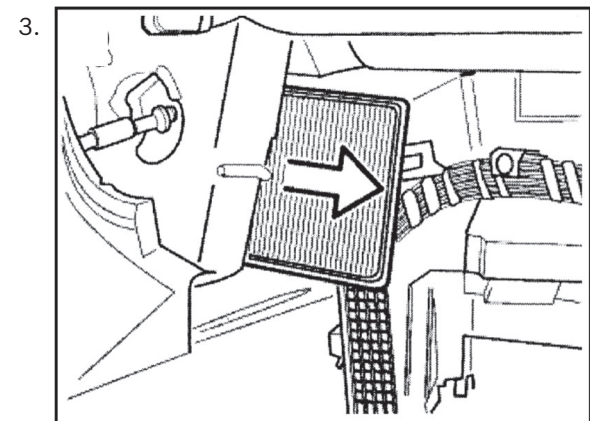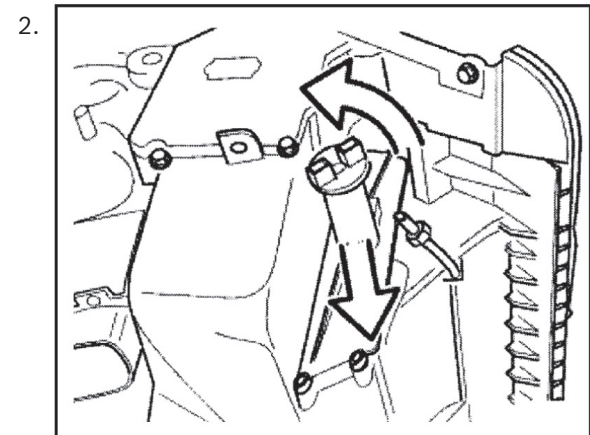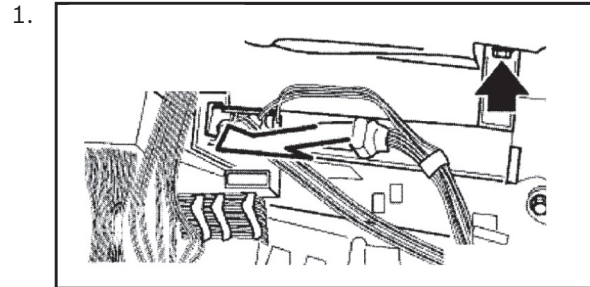

*Instructions may vary by make, model and year.